

stock

RH

U/R

OK 9/16/18

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 1

Item ID: D119-646-241 Accept *N900040100* Setup Start *NS1*
Revision ID: URF 15-560 Stop *NS2*
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 8/5/2016 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: DAS 21 9-89 Date: AUG 02 2016 Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____
Run Start *NR1*
Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-045	DE 17-6-86								
IIN-D119-646	C								
100	Document Control	0.00							
100									
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile & type labels per PPP D119-646-241		CHG003						

N/A

110 0.00
110
Skidtubes Memo 0.07
Skidtubes
1- inspect Mat'L D2500-1-190 for damage
2-Cut tube to length as per dwg D3887 (154.8")
3- Ensure squareness of ends and scribe batch#

>

16-11-7

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table border="0"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																
Description Work Order Deviation				Disposition				Completed By																																																															
								Lead hand / Supervisor Approval Verification																																																															
								QC / QA Coordinator Approval																																																															
Root Cause <table border="0"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>				Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table border="0"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>				Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
OTHER :																																																																							

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 2

Item ID: D119-646-241 **Accept**
Revision ID: URF 15-560
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 **Start Qty:** 1.00 ***1***
Required Date: 8/5/2016 **Req'd Qty:** 1.00 ***1***
Reference:

N900040100

Setup Start ***NS1***
Stop ***NS2***

Cust Item ID:
Customer:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.07							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

DAS
18
9-89DAS
74
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step # : _____		QTY Effective : _____			MRB (QS1042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By 		
							Lead hand / Supervisor Approval Verification 		
QC / QA Coordinator Approval 									

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____ 			
Misidentified ☐		Past Due ☐					

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 3

Item ID: D119-646-241 Accept
Revision ID: URF 15-560
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 Start Qty: 1.00 *1*
Required Date: 8/5/2016 Req'd Qty: 1.00 *1*
Reference:

N900040100

Setup Start *NS1*
Stop *NS2*

Cust Item ID:
Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start *NR1*
Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130		0.00							
130 Skidtubes	Memo	0.16							
Skidtubes	1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.								
	2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.								
	3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477								
	4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***								
	5- Deburr, blow out chips from inside of tube.								
	6- Bond web in place as per Dwg D3887 & QSI 015. A/RSikaflex-291 <u>136093</u> Sikaflex expire date: <u>17-2-16</u> Start: _____ Time: _____ Finish: _____ Time: <u>9:00</u> ***** (Adhere for 12 hours) *****								

16-11-15 DT. AS

16-12-2 JH

QA Closed: _____ Date: _____



Work Order update only ☐

H:/FORMS/Quality Assurance\approved QA/NCRWO Rev I

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 4

Item ID: D119-646-241 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 8/5/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
135	QC5- Inspect part completeness to step on W/O	0.00							
135									
QC	Memo	0.00							
Quality Control									

DAS
03
8-89  16-12-5

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date : _____	Step #: _____	QTY Effective : _____			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
2-51-01 <i>[Signature]</i>		<i>[Signature]</i>			Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY				
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : _____						

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 5

Item ID: D119-646-241 **Accept**
Revision ID: URF 15-560
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 **Start Qty:** 1.00 ***1***
Required Date: 8/5/2016 **Req'd Qty:** 1.00 ***1***
Reference:

N900040100

Setup Start *NS1*
Stop *NS2*

Cust Item ID:
Customer:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run Start *NR1*
Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140		0.01							
140 Skidtube	Memo	0.17							
Skidtube	1- Bend FWD end of tube using bender 1 and bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***								
	2- Cut FWD end of tube as per dwg D3887.***Verify measurement***								
	3- Buff out marks left from bending								
	4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"								
	5- Open FWD saddle holes to finished size as per dwg D3887								
	6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)								
	7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size.								
	8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.								
	9- C'sink FWD cap hole as per detail "C"								
	10- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.								
	11- Deburr and blow out chips from inside of tube.								

16-12-5 JH/DP

16-12-06 DT JH

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 6

Item ID: D119-646-241 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 8/5/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150 QC5- Inspect part completeness to step on W/O 0.00

150

QC

Quality Control

Memo

0.00

1 0 16-12-09

160 0.00

160

Skidtubes

Skidtubes

Memo

0.19

NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/R Aluminum Rod M133730

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore x-bolt spacer holes as per Dwg D3887.

4-Deburr and blow out chips from inside of tub

BE 16-12-13
16-12-13
16-12-14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Cross tube ☐ Water Jet ☐ Engineering ☐ Machining ☐ Small Fab ☐ Prod. Eng. Coord. ☐ Quality ☐ Thermoforming ☐ Finishing ☐ Rec/Store/Packaging ☐ Other ☐ Large Fab ☐ Composite ☐ Supplier ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER :									

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 7

Item ID: D119-646-241
Revision ID: URF 15-560
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 **Start Qty:** 1.00 ***1***
Required Date: 8/5/2016 **Req'd Qty:** 1.00 ***1***
Reference:

Accept***N900040100*****Setup Start *NS1*****Stop *NS2*****Cust Item ID:****Customer:**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run Start *NR1***Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170 *170* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo TEST FIT USING FIXTURE DT10091.	0.00 0.06				1			DAS 38 9-89 DEC 14 2016
180 *180* QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00				1			DAS 38 DEC 14 2016
190 *190* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo	0.00 0.10				(X) 1			2016/12/15 BEB (1) 2017-08-30 JSL BEB

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. _____		Rework ☐		Skid-tube ☐		Cross tube ☐		Water Jet ☐		Engineering ☐	
NCR No. _____		Scrap ☐		Machining ☐		Small Fab ☐		Prod. Eng. Coord. ☐		Quality ☐	
		Use-as-is ☐		Thermoforming ☐		Finishing ☐		Rec/Store/Packaging ☐		Other ☐	
		Suspected Unapproved ☐		Large Fab ☐		Composite ☐		Supplier ☐			
Date : _____		Step #: _____		QTY Effective : _____				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition							
								Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐						
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐						
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐						
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐						
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐						
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐						
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐						
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐						
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐						
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐						
Past Expiry Date ☐	Manufacturing Process ☐										
Misidentified ☐	Past Due ☐	OTHER : _____									

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Cross tube ☐ Water Jet ☐ Engineering ☐ Machining ☐ Small Fab ☐ Prod. Eng. Coord. ☐ Quality ☐ Thermoforming ☐ Finishing ☐ Rec/Store/Packaging ☐ Other ☐ Large Fab ☐ Composite ☐ Supplier ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER :									

Monday, July 25, 2016 2:27:28 PM

149541

Page 9

Item ID:	D119-646-241	Accept
Revision ID:	URF 15-560	
Item Name:	Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH	
Start Date:	8/2/2016	Start Qty: 1.00 *1*
Required Date:	8/5/2016	Req'd Qty: 1.00 *1*
Reference:		

N900040100

```

Setup  Start  *NS1*
          Stop   *NS2*

```

Cust Item ID:
Customer:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run	Start	*NR1*
	Stop	*NR2*

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. _____		Rework ☐		Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐		
NCR No. _____		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 149541

Monday, July 25, 2016 2:27:28 PM

149541

Page 10

Item ID: D119-646-241 **Accept**
Revision ID: URF 15-560
Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH
Start Date: 8/2/2016 **Start Qty:** 1.00 ***1***
Required Date: 8/5/2016 **Req'd Qty:** 1.00 ***1***
Reference:

N900040100

Setup Start ***NS1***
Stop ***NS2***

Cust Item ID:
Customer:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	Identify as per dwg & Stock Location: <i>W/O</i>	0.00							
260									
Packaging	Memo <i>165093</i>	0.00				<i>1X</i>			<i>17/07/2016</i>
Packaging	Location : FG084								
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.02							<i>17/9/25</i>
Quality Control									

DAS
21 SEP 22 2017
9-88

QA Closed: Date:

DART
AEROSPACE

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework Scrap Use-as-is Suspected Unapproved		AGAINST DEPARTMENT/PROCESS Skid-tube Machining Thermoforming Large Fab Cross tube Small Fab Finishing Composite Water Jet Prod. Eng. Coord. Rec/Store/Packaging Supplier Engineering Quality Other					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment Design Doc/Data Equip/Tooling Handling/Pre Material Internal Transport Tribal Knowledge LOA Substation Past Expiry Date Misidentified No Re-verification Operator Offset/Setup Supplier Training Use for Testing Poor Information Rushing Product Improvement Process Improvement Manufacturing Process Past Due		FAULT CATEGORY Pressure/Forced Bending Centre Not Concentric Cracks Crimp/Kink/Ripple/Wave Cuffs Crushing Heat Treat Wave/Twist in Tube Marks/Chatter Temperature/Cure Set-up BOM/Route Broken/Damage/Defect Inspection Incomplete/Unqualified Contamination Countersink Cut Too Short Instructions Incomplete/Unclear Drill Holes Power Loss/Surge Folio/Program Grain Weld Wrong Stock Pulled Out of Sequence Off-set Mislabeled Fit/Function Misaligned/off center Positioned Wrong Outside Dimensions Over/Under tolerance Part Incorrect Part Lost/Missing Part Moved Drawing Finish Misread Turning Sequence							
		OTHER :							

Picklist Print

Monday, July 25, 2016 2:27:28 PM

Page 1

Work Order ID: 149541

149541

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH

Start Date: 8/2/2016

Required Date: 8/5/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
12.11.05 (DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:C 13.03.20
per chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured

No

110

Each

87.0000

1

1

D2500-1-190

Ext'n -T Beam Tube 4"

**

Location

Loc Qty

Loc Code

HALL

84

145247

84

LG002

3

140538

3

D2579

Manufactured

No

140

Each

159.0000

2

2

D2579

Crossbolt Spacer

**

Location

Loc Qty

Loc Code

LG001

159

123997

1

141711

158

D2855-3

Manufactured

No

240

Each

90.0000

2

2

D2855-3

Cap

**

Location

Loc Qty

Loc Code

FP001

90

142564

90

13153 291

x2

DAS
03
9-8-8
17-6-6

DD 16-11-7
1
BE 16-12-09
2
20
22 12/09/20

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : _____									

Picklist Print

Monday, July 25, 2016 2:27:28 PM

Page 2

Work Order ID: 149541

149541

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH

Start Date: 8/2/2016

Required Date: 8/5/2016

Start Qty: 1.00

Required Qty: 1.00

D3672-1 Manufactured No 240 Each 984.0000 2 2

D3672-1

Washer, Phenolic

**

all 12/09/20

Location

Loc Qty

Loc Code

FG	10	B150074	x2
85222	10		
FP001	474		
112218	4		
134785	470		
ST049	500		
147077	500		

D3681-1 Manufactured No 160 Each 172.0000 8 8

D3681-1

Spacer

**

+4

BE1612-09

Location

Loc Qty

Loc Code

LG001	172		
145956	60		
147557	112		

B152459 x8
B158384 x2
B160402 x2

D3849-041 Manufactured No 240 Each 4.0000 1 1

D3849-041

Run-On Landing Wearplate Fwd for Standard Skidtubes

**

all 12/09/20

Location

Loc Qty

Loc Code

FP002	4	B165671	x1
133876	4		

D3849-043 Manufactured No 240 Each 0.0000 1 1

D3849-043

Run-On Landing Wearplate Aft for Standard Skidtubes

**

B163871 (1x) all 12/09/20

Monday, July 25, 2016 2:27:28 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Picklist Print

Monday, July 25, 2016 2:27:28 PM

Page 3

Work Order ID: 149541

149541

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH

Start Date: 8/2/2016

Required Date: 8/5/2016

Start Qty: 1.00

Required Qty: 1.00

D3885-1 Manufactured No

140

Each

32.0000

1

1

D3885-1

Standard Web

**

16-12-2 JH

Location

Loc Qty

Loc Code

LG002

142573

32

7

146232

25

①

D3903-1 Manufactured No

160

Each

105.0000

12

12

D3903-1

Spacer

**

BE 16-12-09
8162993 x 12

Location

Loc Qty

Loc Code

LG001

105

142730

105

D3904-1 Manufactured No

240

Each

176.0000

16

16

D3904-1

Washer

**

all 12/09/12

Location

Loc Qty

Loc Code

FP001

176

133289

76

141452

100

13163580

x16

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval			
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
				OTHER :							

Picklist Print

Monday, July 25, 2016 2:27:28 PM

Page 4

Work Order ID: 149541

149541

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH

Start Date: 8/2/2016

Required Date: 8/5/2016

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

240

Each

1,292.000

2

2

AN3C5A

Bolt

all 12/09/20

Location

Loc Qty

Loc Code

FG

5

M1137963

x2

122800

5

FP001

80

M134502

80

OVER002

900

M134955

300

M135297

600

ST350

307

M133234

1

M134676

306

AN3C46A

Purchased

No

240

Each

254.0000

8

8

AN3C46A

Bolt

all 12/09/20

Location

Loc Qty

Loc Code

FG

10

122843

10

M1138009

x8

OVER002

140

134795

70

M134794

70

ST346

104

M132522

33

M133917

21

M134591

50

Monday, July 25, 2016 2:27:28 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date : _____	Step #: _____	QTY Effective : _____			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : _____						

Picklist Print

Monday, July 25, 2016 2:27:28 PM

Work Order ID: 149541

149541

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-on Landing Wearplates, Fits LH or RH

Start Date: 8/2/2016

Required Date: 8/5/2016

Start Qty: 1.00

Required Qty: 1.00

MS21043-3

Purchased

No

240

Each

920.0000

8

8

MS21043-3

**

Nut

all val 08/20

Location

Loc Qty

Loc Code

FG

80

M136182

103691

80

28

FP001

11

m130673

11

GA

237

m133990

237

OVER007

400

m135058

400

ST302

86

m134861

86

ST304

106

m131340

106

MS24694-C52

Purchased

No

Each

53.0000

2

MS24694-C52

**

SCREW

all val 08/20

Location

Loc Qty

Loc Code

FP001

47

M1135970

m127059

17

x2

m133855

30

ST287

6

124308

6

*17-6-16
DAS
03
9-10*

D2855-5 Cop

B

①

ALS7-1032-225 insert

B

①

all val 08/20 (x1)

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Cross tube ☐ Water Jet ☐ Engineering ☐ Machining ☐ Small Fab ☐ Prod. Eng. Coord. ☐ Quality ☐ Thermoforming ☐ Finishing ☐ Rec/Store/Packaging ☐ Other ☐ Large Fab ☐ Composite ☐ Supplier ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition			Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER :							

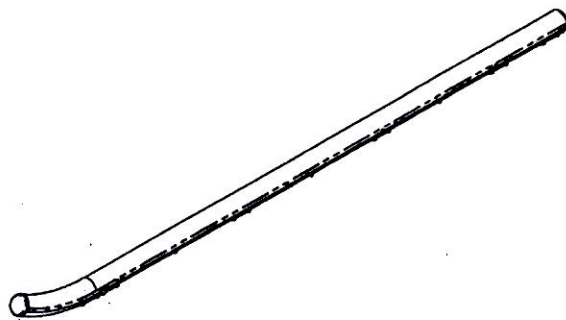

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 149541 KLS
16-08-02

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES
ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT
PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT
PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE
WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO $\phi 0.197$ HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL $\phi 0.297$ HOLES FOR WEARPLATE INSERTS.
INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS
WITH SIKAFLEX-241/-291.

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2679	CROSS BOLT SPACER
11	2	2	2	D2856-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3872-1	PHENOLIC WASHER
14	8	8	8	D3881-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT TRAINING WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
28			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		ALS4-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C48A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-C52	SCREW

RELEASED

UNDER REVIEW

2016 NOV 24

15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 136.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.6 (ZN D5-8), DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SH 1, PL 2, ZN C2-2, C2-2 C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) 90.201 CSK 90.385 X 100 WAS 90.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2679 CROSS BOLT SPACER (ZN D4-1, A8-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN D4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1), ADD 134.04 (ZN C4-8), D2856-3 WAS D2875 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C2-3, C6-4, C2-4), $\phi 0.313$ WAS $\phi 0.328$ (ZN C4-5, C4-3, C2-7 & B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF		
DRAWN	DB		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.09.20		

DART AEROSPACE USA, INC.
KENT, WA
DRAWING NO. D3887
REV. D
SHEET 1 OF 8
SCALE NTS
COPYRIGHT © 1990 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

1.5 1.5
1.5 1.5

2.00 DISTANCE TO D3885-1 WEB, REF

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

1.5 1.5

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24894-CS2 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *CP*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE OPEN SOURCE BASIS. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF.

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24684-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 4P

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

D3949-041
FWD TRAINING WEARPLATE ASSY

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24894-C52 SCREW
(1 PER SIDE)

UNDER REVIEW


15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

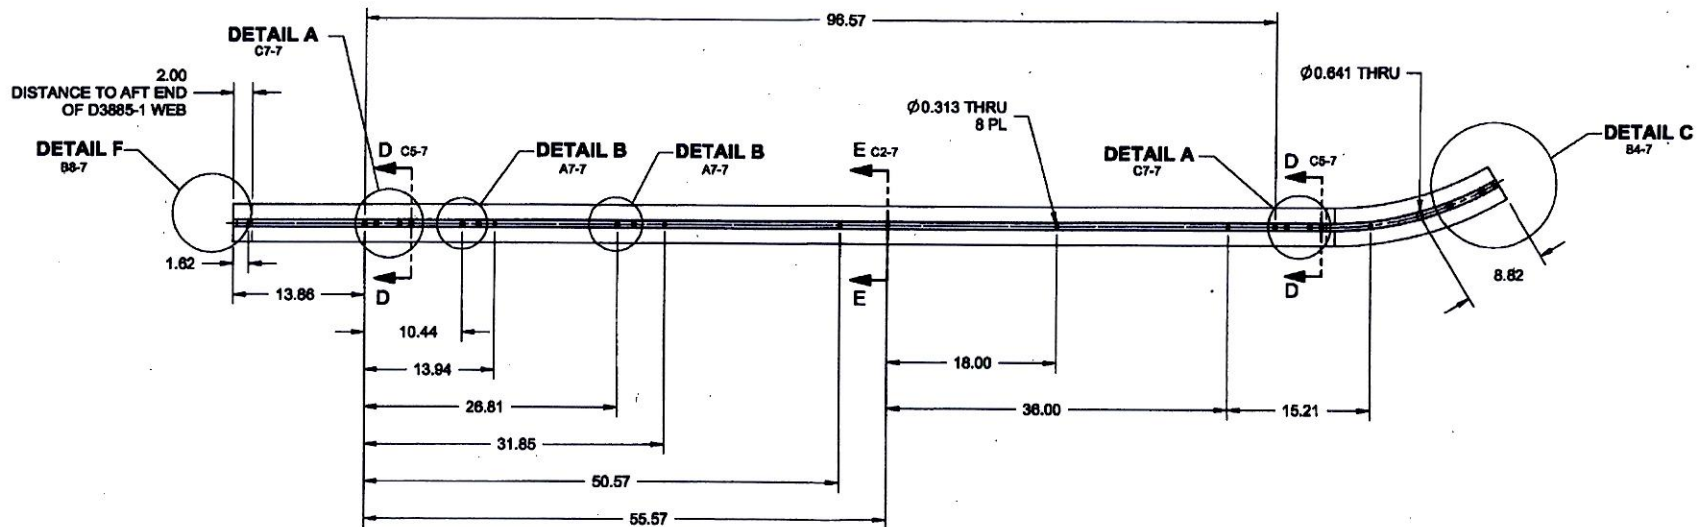

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *up*


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

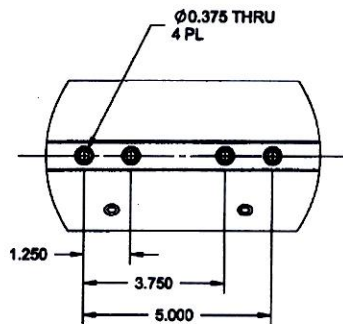


DETAIL A
SCALE 4X
D7-5
C3-6
D7-6
C3-6

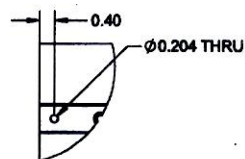


DETAIL F
SCALE 4X
C8-5
C8-6

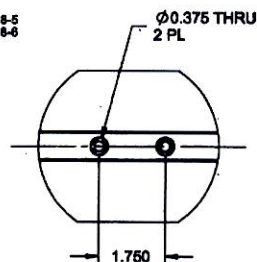

DETAIL B
SCALE 4X
C8-6
C5-5
C8-6
C5-6

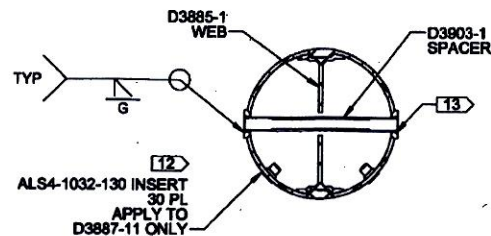

SECTION D-D
SCALE 4X
(FOR 12 X Ø0.375 HOLES
PER SKIDTUBE)
C7-5
C3-6
C7-6
C2-6

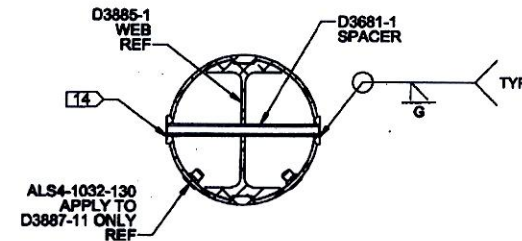

SECTION E-E
SCALE 4X
(FOR 8 X Ø0.313 HOLES
PER SKIDTUBE)
C4-5
C4-6

NOTES:

13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

- i) CHAMFER HOLES Ø0.475 x 45°
- ii) INSERT D3803-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) BORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:


- vi) CHAMFER HOLES Ø0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES

UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED


2014 NOV 24

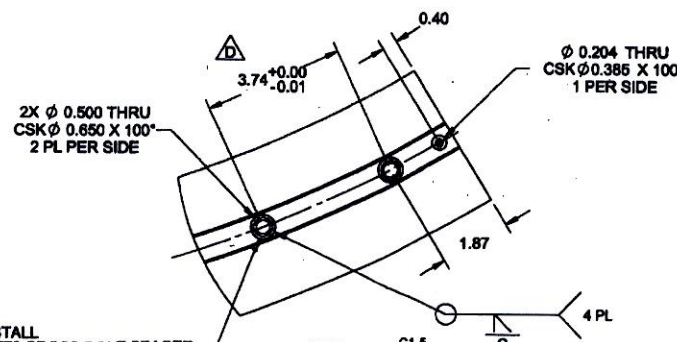

DETAIL C
SCALE 4X
C1-5
C1-6

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	h	DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON OR ENTITY WITHOUT PERMISSION FROM DART AEROSPACE USA, INC.	

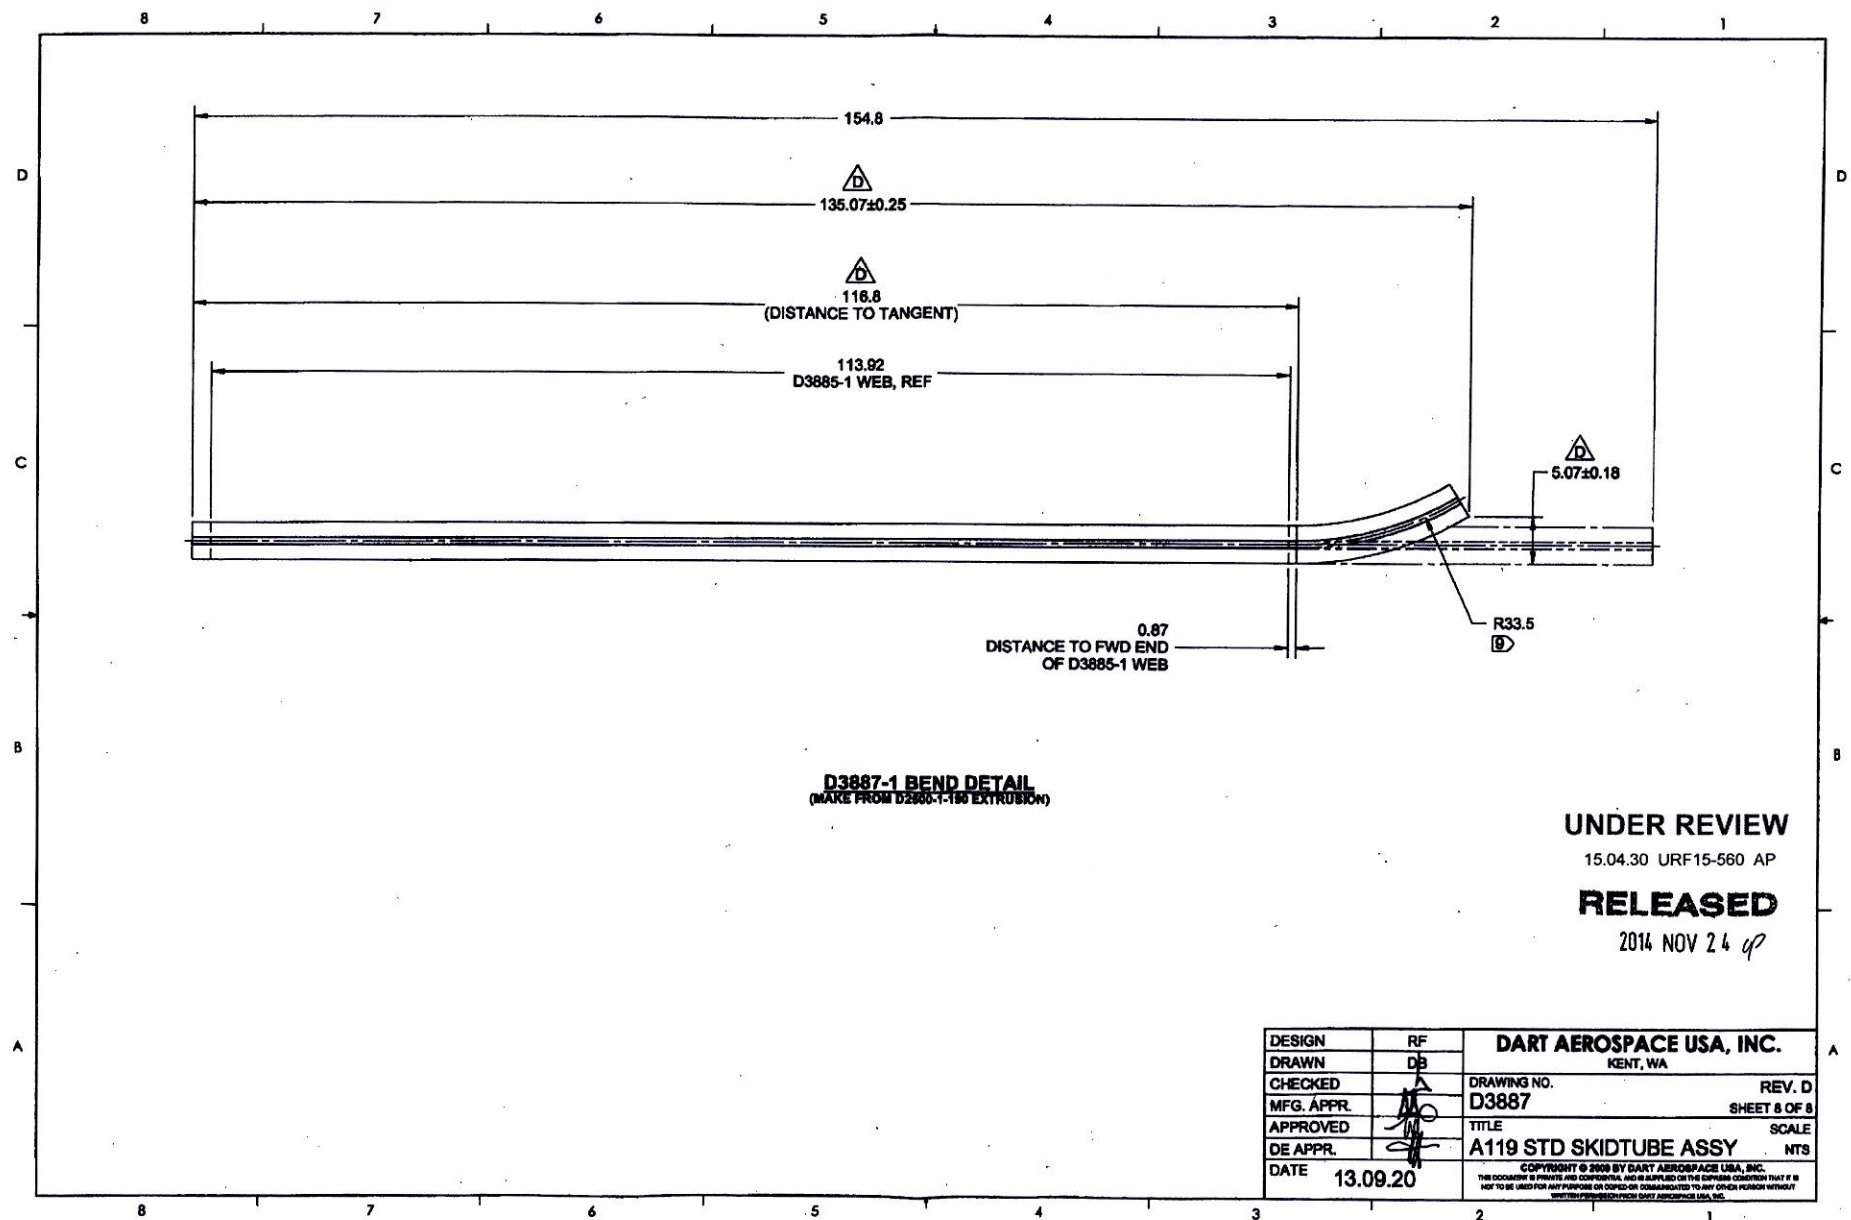

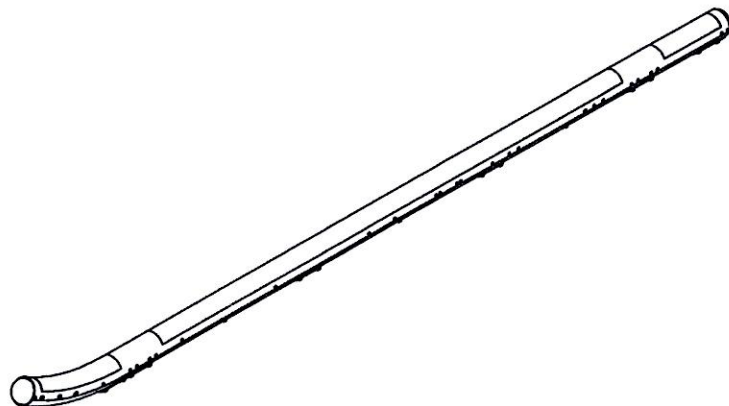

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD(SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 149541
 JUN 06 2017

E	COMPLETE REDRAW, ADDED ASSY DETAILS -3, -051 & -053, SEE PREVIOUS REV. FOR DETAIL. POWDER COAT REMOVED FROM SADDLE AREA SEE DETAIL F, REF PAR17-521. ADDED STRUCTURAL PROVISIONS TO ALLOW FOR THE INSTALLATION OF THE D119-848-313/314 SKIDTUBE PROTECTOR KIT, REF PAR17-577. CHANGE QTY OF D2855-3, ADDED D2855-5 CAP ASSEMBLIES, ADDED INSTRUCTIONS TO LOCATE INSERT HOLE FOR D2855-5 CAP, REF PAR17-583.	AJS / WK	17.02.03
D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH 2).	DB	13.09.20
C	(SHT1, PL, ZN C2-2, C3-2 C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3CSA, 2 PLCS, (ZN C1-5, C1-8, B4-7) Ø0.201 CSK Ø0.385 X 100" WAS Ø0.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A6-7).	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A6-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3CSA WAS AN3C-4A (ZN C5-2, C2-2, C6-3, C2-3, C6-4, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE N (ZN B3-7).	RF	09.08.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION		
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 1 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
 2017-05-08
 17-519

D





A

AL
CAP.

A

ITEM	QTY -043	P/N	DESCRIPTION
	X	D3887-043	STANDARD SKIDTUBE ASSY WITH WEARPLATE
1	1	D2855-3	CAP ASSY
2	1	D2855-5	CAP ASSY
3	24	D3492-045	PLUG ASSY
4	2	D3672-1	PHENOLIC WASHER
5	1	D3847-043	FWD WEARPLATE ASSY
6	1	D3847-045	CENTER WEARPLATE ASSY
7	1	D3847-047	AFT WEARPLATE ASSY
8	5	D3847-1	WEARPAD
9	1	D3847-11	WEARPAD
10	1	D3887-051	SKIDTUBE ASSY
11	1	ALS4-1032-225	INSERT
12	32	AN3C5A	BOLT
13	2	MS24694-C52	SCREW, CSK 100°
14	32	NAS1149C0332R	WASHER

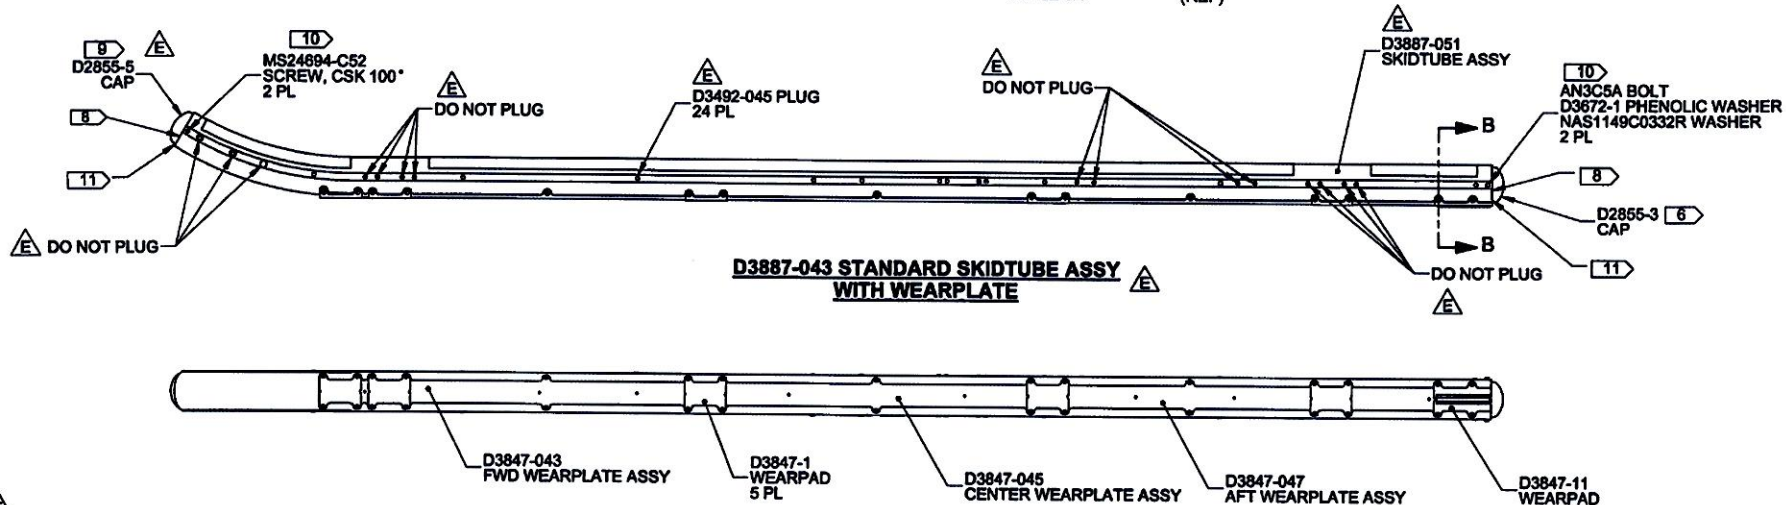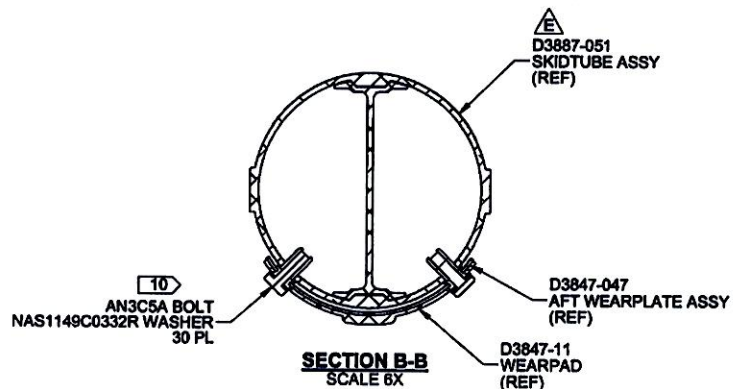

NOTES:



- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3887-043" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 37.0 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3887-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP. OPEN HOLE TO Ø0.297, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 3 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

ITEM	QTY -045	P/N	DESCRIPTION
	X	D3887-045	STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
1	1	D2855-3	CAP ASSY
2	1	D2855-5	CAP ASSY
3	8	D3492-045	PLUG
4	2	D3672-1	PHENOLIC WASHER
5	1	D3849-041	FWD WEARPLATE ASSY, STD GEAR
6	1	D3849-043	AFT WEARPLATE ASSY, STD GEAR
7	1	D3887-053	SKIDTUBE ASSY
8	16	D3904-1	WASHER
9	1	ALS4-1032-225	INSERT
10	8	AN3C46A	BOLT
11	2	AN3C5A	BOLT
12	8	MS21043-3	NUT, SELF-LOCKING
13	2	MS24894-C52	SCREW, CSK 100°
14	2	NAS1149C0332R	WASHER

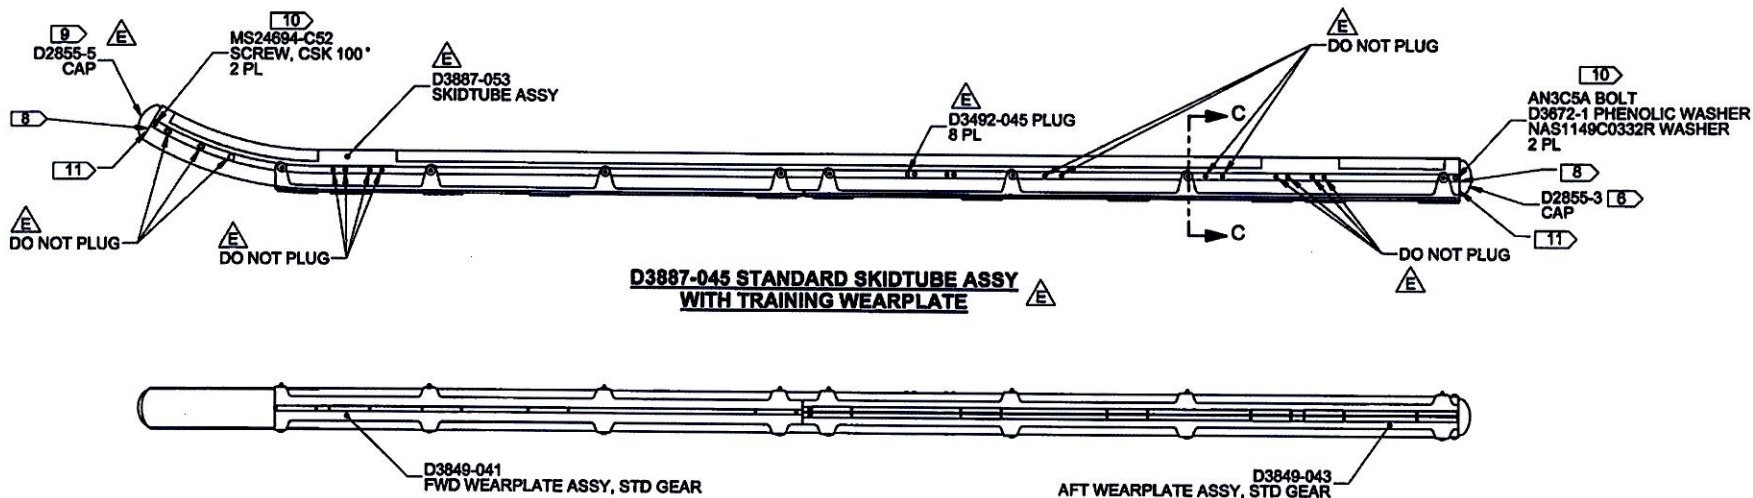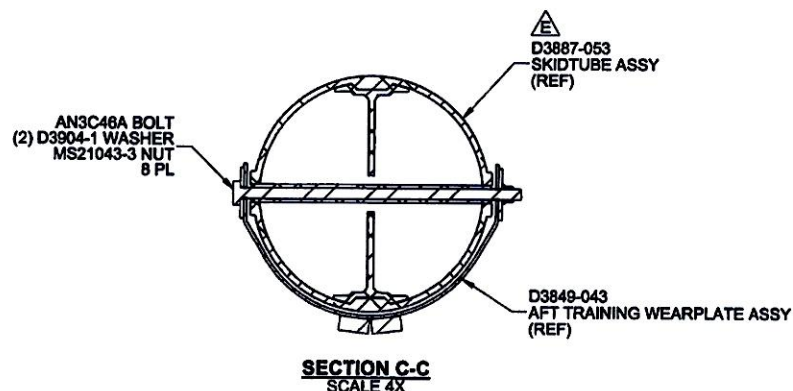

NOTES:
1) MATERIAL: N/A
2) FINISH: NONE
3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
4) UNITS: INCHES UNLESS OTHERWISE NOTED
5) BREAK SHARP EDGES: N/A
6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3887-045" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP

7) WEIGHT: 38.1 lbs
8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
9) USE D3887-053 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP. OPEN HOLE TO Ø0.297, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
10) SEAL FASTENERS WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT


RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.
DRAWN	WK	EUGENE, OR
CHECKED	RF	DRAWING NO. REV. E
MFG. APPR.	DD	D3887 SHEET 4 OF 11
APPROVED	HS	TITLE SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY NTS
DATE	17.02.03	

COPYRIGHT © 2000 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

ITEM	QTY	P/N	DESCRIPTION
	X	D3887-051	SKIDTUBE ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	CROSS BOLT SPACER
3	1	D3885-1	STANDARD WEB
4	1	D3887-11	SKIDTUBE
5	12	D3903-1	CROSS BOLT SPACER
6	30	ALS4-1032-130	INSERT

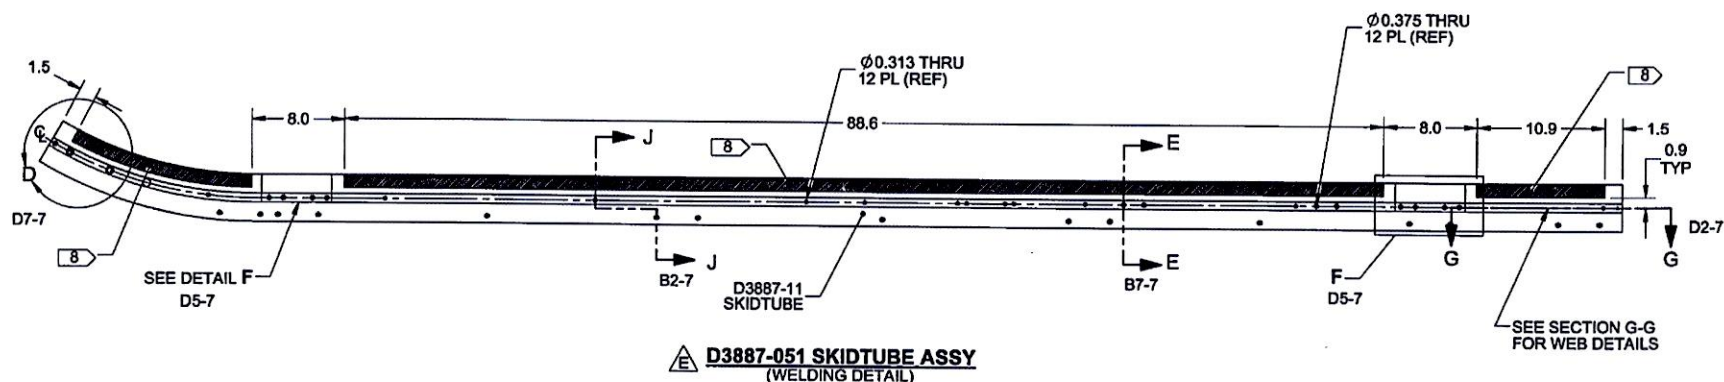

D3887-051 SKIDTUBE ASSY
(WELDING DETAIL)

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50 ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.
DRAWN	WK	EUGENE, OR
CHECKED	RF	DRAWING NO. REV. E
MFG. APPR.	DD	D3887 SHEET 5 OF 11
APPROVED	HS	TITLE SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY NTS
DATE	17.02.03	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

ITEM	QTY	P/N	DESCRIPTION
	X	D3887-053	SKIDTUBE ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	CROSS BOLT SPACER
3	1	D3885-1	STANDARD WEB
4	1	D3887-13	SKIDTUBE
5	12	D3903-1	CROSS BOLT SPACER

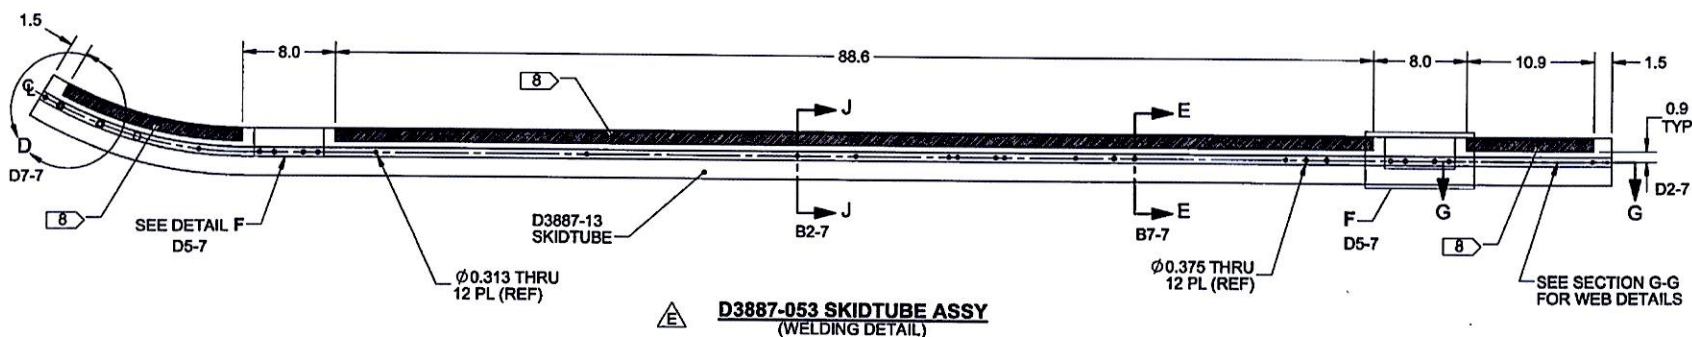

D3887-053 SKIDTUBE ASSY
(WELDING DETAIL)


NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50 ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4


RELEASED
2017-05-08

APPROVED


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 6 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE LOANED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

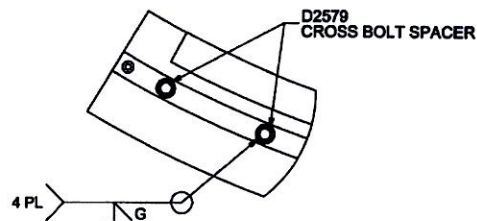


DETAIL D
SCALE 2X
TYP

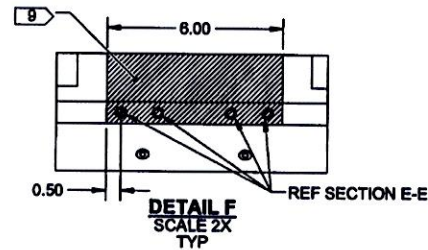

DETAIL F
SCALE 2X
TYP

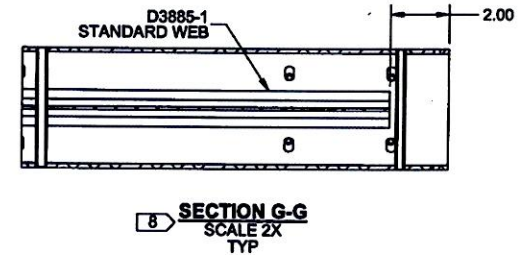


SECTION G-G
SCALE 2X
TYP

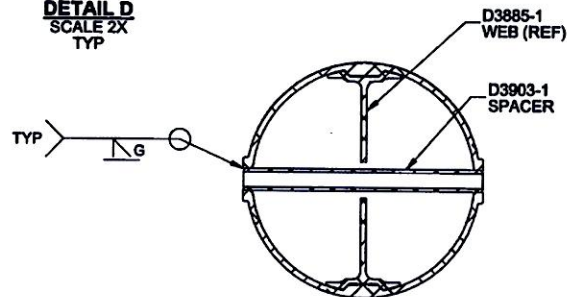

SECTION E-E
SCALE 5X
TYP

(FOR 12X $\phi 0.375$ HOLES
PER SKIDTUBE)

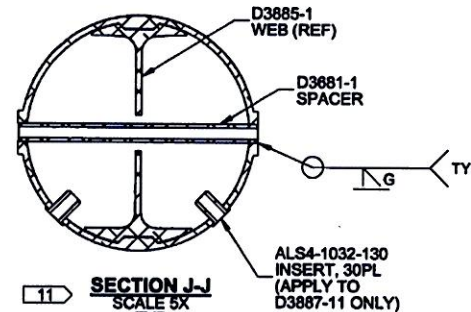

SECTION J-J
SCALE 5X
TYP

(FOR 12X $\phi 0.313$ HOLES
PER SKIDTUBE)


NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 AFTER BENDING. ENSURE HOLES LINE-UP
- 9) MASK THIS AREA AND DO NOT POWDER COAT
- 10) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION E-E $\phi 0.375$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.475 \times 45^\circ$
 - ii) INSERT D3903-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) C'BORE TO $\phi 0.313 \times 0.75$ DEEP
 - v) DEBURR HOLES
- 11) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION J-J $\phi 0.313$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.354 \times 45^\circ$ OR 0.050 DEEP $\times 45^\circ$ (BOTH SIDES)
 - ii) INSERT D3681-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) DEBURR HOLES
- 12) WELD PER DART QSI 004

RELEASED
2017-05-08



APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 7 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

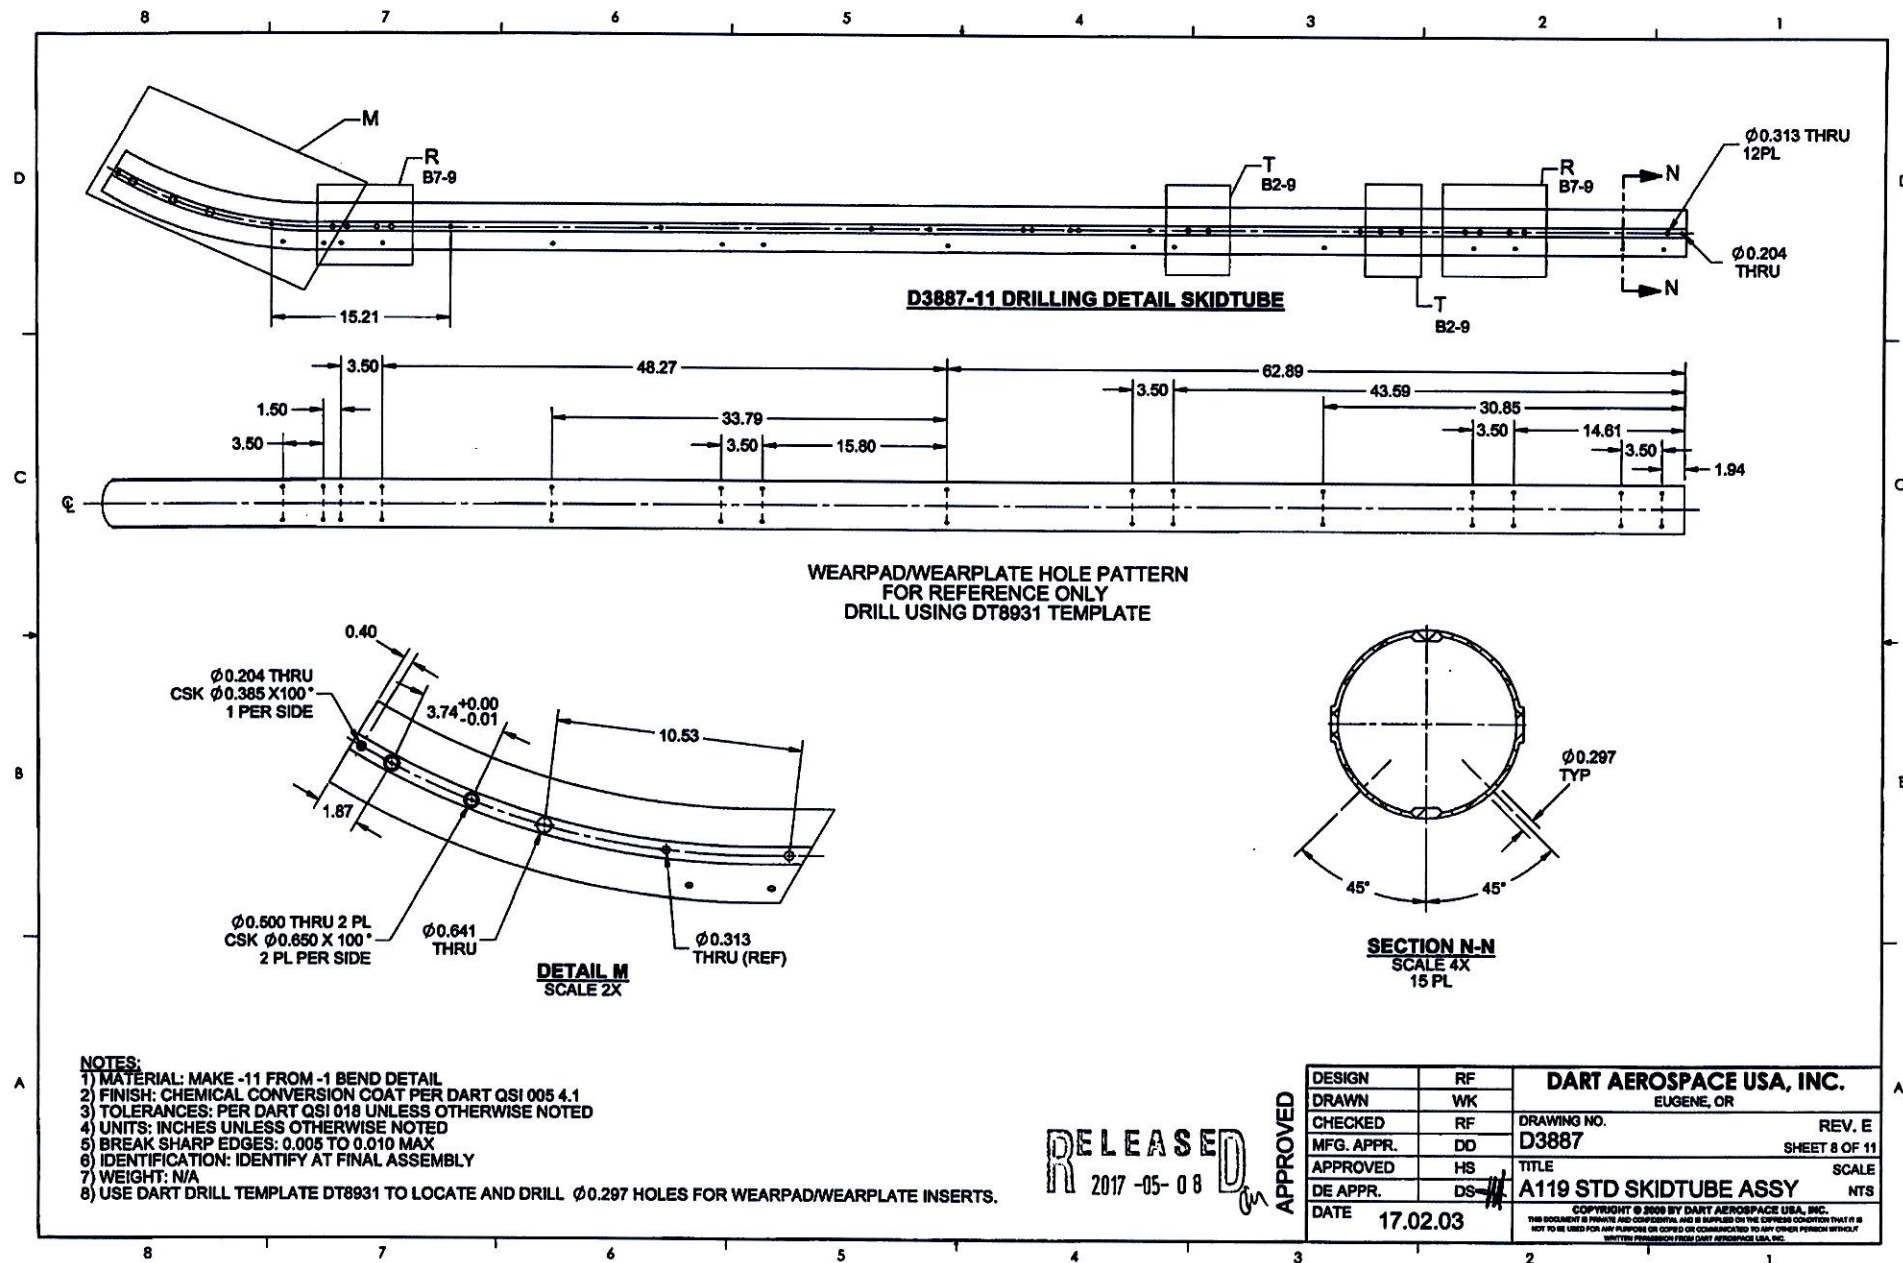

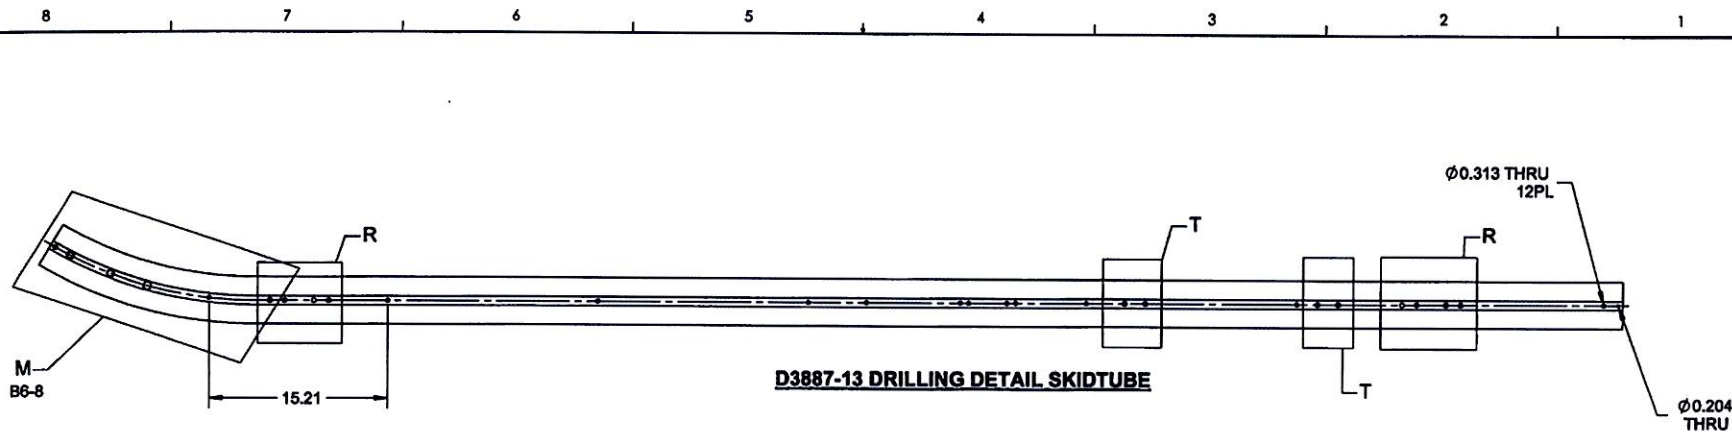

D3887-13 DRILLING DETAIL SKIDTUBE

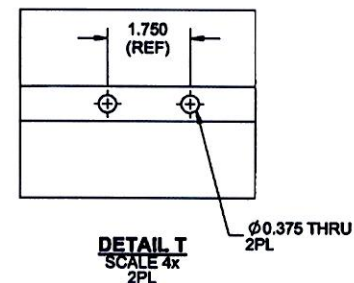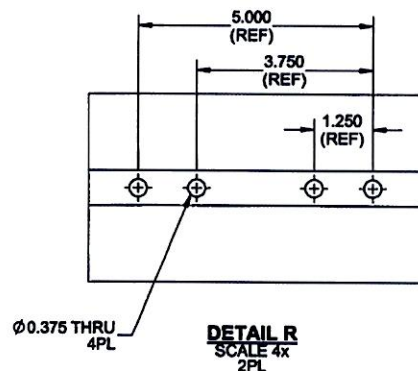

NOTES:

- 1) MATERIAL: MAKE -13 FROM -1 BEND DETAIL
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 9 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

D

D

C


C

B

B

A

A

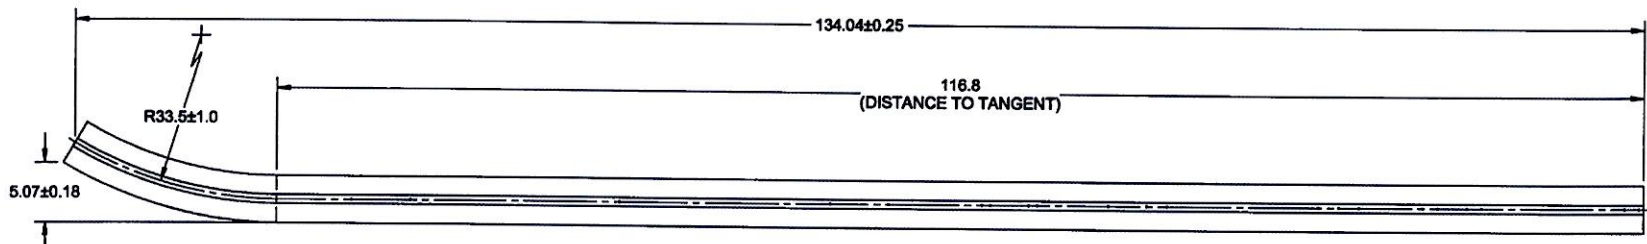

D3887-1 BEND DETAIL SKIDTUBE

NOTES:

- 1) MATERIAL: MAKE -1 BEND DETAIL FROM -3 PILOT HOLE DETAIL
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.


RELEASED
2017-05-08

APPROVED


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 10 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1


8 7 6 5 4 3 2 1

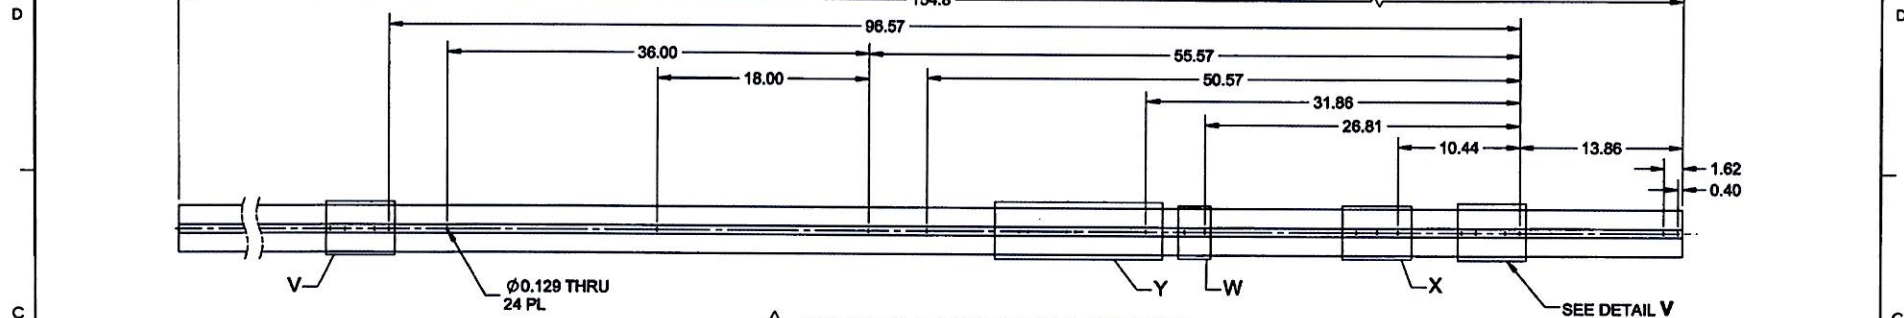


D3887-3 PILOT HOLE DETAIL SKIDTUBE

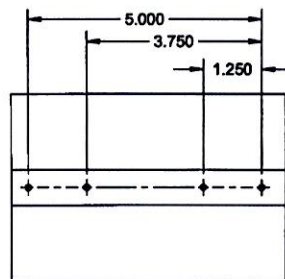


DETAIL V
SCALE 4X
2 PL

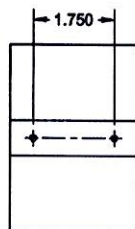

DETAIL W
SCALE 4X

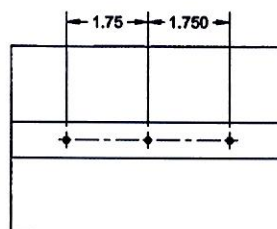

DETAIL X
SCALE 4X

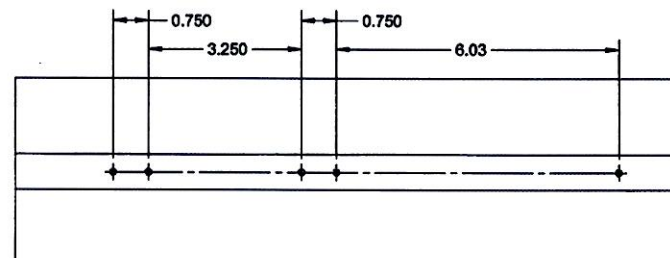

DETAIL Y
SCALE 4X

NOTES:

- 1) MATERIAL: MAKE FROM D2500-1-190 EXTRUSION
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 11 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

Under Review Notification

Raised By: ALEX PHARAND

Product #: D119-646

Date: 15/04/20

Product Name: SKIDTUBES

Part Number (D-Part and 9-Digit)	Drawing/Document & Current Affected Revision	"Y" or "N" Required for Each Part							Reserved ECN Log Number	Instructions Relevant to Each Part
		HOLD SHIPMENT	Red Tag/Quarantine Stock	Advise Customers	Stop Production	Re-Work Stock	IPP Under Review	Product Specifications Under Review		
D3905-1/-11/-13/-041/-043	D3905 Rev. D	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D3905-045	D3905 Rev. D	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D3887-1/-11/-13/-041/-043	D3887 Rev. D	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D3887-045	D3887 Rev. D	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D3883-1/-2	D3883 Rev. C	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D3884-1/-2	D3884 Rev. B	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW
D119-646-X SEE BELOW	IIN-D119-646 Rev. C	N*	N*	N	N	Y	Y	N	15-560	SEE BELOW

Description of Issue:

CROSSBOLT SPACERS CHANGED TO SWAGED ON D3905 AND D3887 SKIDTUBES

FINISH REMOVED FROM BORE OF D3883 AND D3884 SADDLES AND SADDLE LOCATIONS ON D3887 AND D3905 SKIDTUBES

*PRODUCE SKIDTUBES AS REQUIRED TO KEEP MINIMUM STOCK. WILL REQUIRE DISPOSITION FROM ENGINEERING

*SADDLES MAY CONTINUE PRODUCTION WITH DISPOSITION FROM ENGINEERING REGARDING FINISH.

*TOP LEVEL KITS AFFECTED D119-646-011/-012/-013/-014/-041/-043/-111/-112/-113/-114/-141/-143/-151/-153/-211/-212/-213/-214/-241/-243/-251/-253

*All CURRENT STOCK MAY BE SOLD TO NON-AGUSTA CUSTOMERS. SKIDTUBES IN STOCK WITH WELDED SPACERS MAY HAVE FINISH RE-WORKED IF SOLD TO AGUSTA, SADDLES IN STOCK MAY BE RE-WORKED TO REMOVE PAINT PER ENGINEERING DISPOSITION OR CAN BE SOLD AS IS TO NON-AGUSTA CUSTOMERS. TOP LEVEL CHANGE NUMBERS WILL BE AFFECTED, TO BE REFLECTED ON ECN.

Distribution:

VP Operations

Director of Operations

Director Quality Assurance

Director of Engineering

Chief Engineer

Engineering Project Managers

Engineering Clerk

Customer Support Manager

Production Engineers

Planning Manager

Program Manager

Technical Support

Under Review Notification

Raised By: AJS

Product #: D119-646

Date: _____

Product Name: Skidtube

Part Number (D-Part and 9-Digit)	Drawing/Document & Current Affected Revision	"Y" or "N" Required for Each Part							Reserved ECN Log Number	Instructions Relevant to Each Part
		HOLD SHIPMENT	Red Tag/Quarantine Stock	Advise Customers	Stop Production	Re-Work Stock	IPP Under Review	Product Specifications Under Review		
D5101-041/-1	Rev A	Y	Y	N	Y	N	Y	N	N/A	Product underdevelopment.
										Manufacture to current Prelim drawing

Description of Issue:

Part is at Rev B Prelim remove drawing from approved directory to prevent production of part

Distribution:	VP Operations Director of Operations Director Quality Assurance Director of Engineering	Chief Engineer Engineering Project Managers Engineering Clerk Customer Support Manager	Production Engineers Planning Manager Program Manager Technical Support	Purchasing Manager
----------------------	--	---	--	--------------------

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☒

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☒</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date : 16/3/16		Step #: 240		QTY Effective :			MRB (QS1042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
Plug unused holes with AN3C4A Bolts rather than AN3CSA Bolts.				Acceptable																					
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____																			


DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☒

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																																																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																																																																																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																																																																																					
Date : 16/5/16		Step #: 200		QTY Effective :		MRB (QSI042) Approval																																																																																																																																	
Description Work Order Deviation				Disposition																																																																																																																																			
No powder coat on saddle region per customer request.				Acceptable per attached masking instructions																																																																																																																																			
				Completed By 1709-11																																																																																																																																			
				Lead hand / Supervisor Approval Verification																																																																																																																																			
				QC / QA Coordinator Approval																																																																																																																																			
Root Cause <table style="width:100%;"> <tr><td>Environment</td><td>☐</td><td>No Re-verification</td><td>☐</td></tr> <tr><td>Design</td><td>☐</td><td>Operator</td><td>☐</td></tr> <tr><td>Doc/Data</td><td>☐</td><td>Offset/Setup</td><td>☐</td></tr> <tr><td>Equip/Tooling</td><td>☐</td><td>Supplier</td><td>☐</td></tr> <tr><td>Handling/Pre</td><td>☐</td><td>Training</td><td>☐</td></tr> <tr><td>Material</td><td>☐</td><td>Use for Testing</td><td>☐</td></tr> <tr><td>Internal Transport</td><td>☐</td><td>Poor Information</td><td>☐</td></tr> <tr><td>Tribal Knowledge</td><td>☐</td><td>Rushing</td><td>☐</td></tr> <tr><td>LOA</td><td>☐</td><td>Product Improvement</td><td>☐</td></tr> <tr><td>Substation</td><td>☐</td><td>Process Improvement</td><td>☐</td></tr> <tr><td>Past Expiry Date</td><td>☐</td><td>Manufacturing Process</td><td>☐</td></tr> <tr><td>Misidentified</td><td>☐</td><td>Past Due</td><td>☐</td></tr> </table>		Environment	☐	No Re-verification	☐	Design	☐	Operator	☐	Doc/Data	☐	Offset/Setup	☐	Equip/Tooling	☐	Supplier	☐	Handling/Pre	☐	Training	☐	Material	☐	Use for Testing	☐	Internal Transport	☐	Poor Information	☐	Tribal Knowledge	☐	Rushing	☐	LOA	☐	Product Improvement	☐	Substation	☐	Process Improvement	☐	Past Expiry Date	☐	Manufacturing Process	☐	Misidentified	☐	Past Due	☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced</td><td>☐</td> <td>Temperature/Cure</td><td>☐</td> <td>Power Loss/Surge</td><td>☐</td> <td>Positioned Wrong</td><td>☐</td> </tr> <tr> <td>Bending</td><td>☐</td> <td>Set-up</td><td>☐</td> <td>Folio/Program</td><td>☐</td> <td>Outside Dimensions</td><td>☐</td> </tr> <tr> <td>Centre Not Concentric</td><td>☐</td> <td>BOM/Route</td><td>☐</td> <td>Grain</td><td>☐</td> <td>Over/Under tolerance</td><td>☐</td> </tr> <tr> <td>Cracks</td><td>☐</td> <td>Broken/Damage/Defect</td><td>☐</td> <td>Weld</td><td>☐</td> <td>Part Incorrect</td><td>☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave</td><td>☐</td> <td>Inspection Incomplete/Unqualified</td><td>☐</td> <td>Wrong Stock Pulled</td><td>☐</td> <td>Part Lost/Missing</td><td>☐</td> </tr> <tr> <td>Cuffs</td><td>☐</td> <td>Contamination</td><td>☐</td> <td>Out of Sequence</td><td>☐</td> <td>Part Moved</td><td>☐</td> </tr> <tr> <td>Crushing</td><td>☐</td> <td>Countersink</td><td>☐</td> <td>Off-set</td><td>☐</td> <td>Drawing</td><td>☐</td> </tr> <tr> <td>Heat Treat</td><td>☐</td> <td>Cut Too Short</td><td>☐</td> <td>Mislabeled</td><td>☐</td> <td>Finish</td><td>☐</td> </tr> <tr> <td>Wave/Twist in Tube</td><td>☐</td> <td>Instructions Incomplete/Unclear</td><td>☐</td> <td>Fit/Function</td><td>☐</td> <td>Misread</td><td>☐</td> </tr> <tr> <td>Marks/Chatter</td><td>☐</td> <td>Drill Holes</td><td>☐</td> <td>Misaligned/off center</td><td>☐</td> <td>Turning Sequence</td><td>☐</td> </tr> </table>						Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Environment	☐	No Re-verification	☐																																																																																																																																				
Design	☐	Operator	☐																																																																																																																																				
Doc/Data	☐	Offset/Setup	☐																																																																																																																																				
Equip/Tooling	☐	Supplier	☐																																																																																																																																				
Handling/Pre	☐	Training	☐																																																																																																																																				
Material	☐	Use for Testing	☐																																																																																																																																				
Internal Transport	☐	Poor Information	☐																																																																																																																																				
Tribal Knowledge	☐	Rushing	☐																																																																																																																																				
LOA	☐	Product Improvement	☐																																																																																																																																				
Substation	☐	Process Improvement	☐																																																																																																																																				
Past Expiry Date	☐	Manufacturing Process	☐																																																																																																																																				
Misidentified	☐	Past Due	☐																																																																																																																																				
Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐																																																																																																																																
Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐																																																																																																																																
Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐																																																																																																																																
Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐																																																																																																																																
Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐																																																																																																																																
Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐																																																																																																																																
Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐																																																																																																																																
Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐																																																																																																																																
Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐																																																																																																																																
Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐																																																																																																																																
		☒ OTHER : Customer																																																																																																																																					

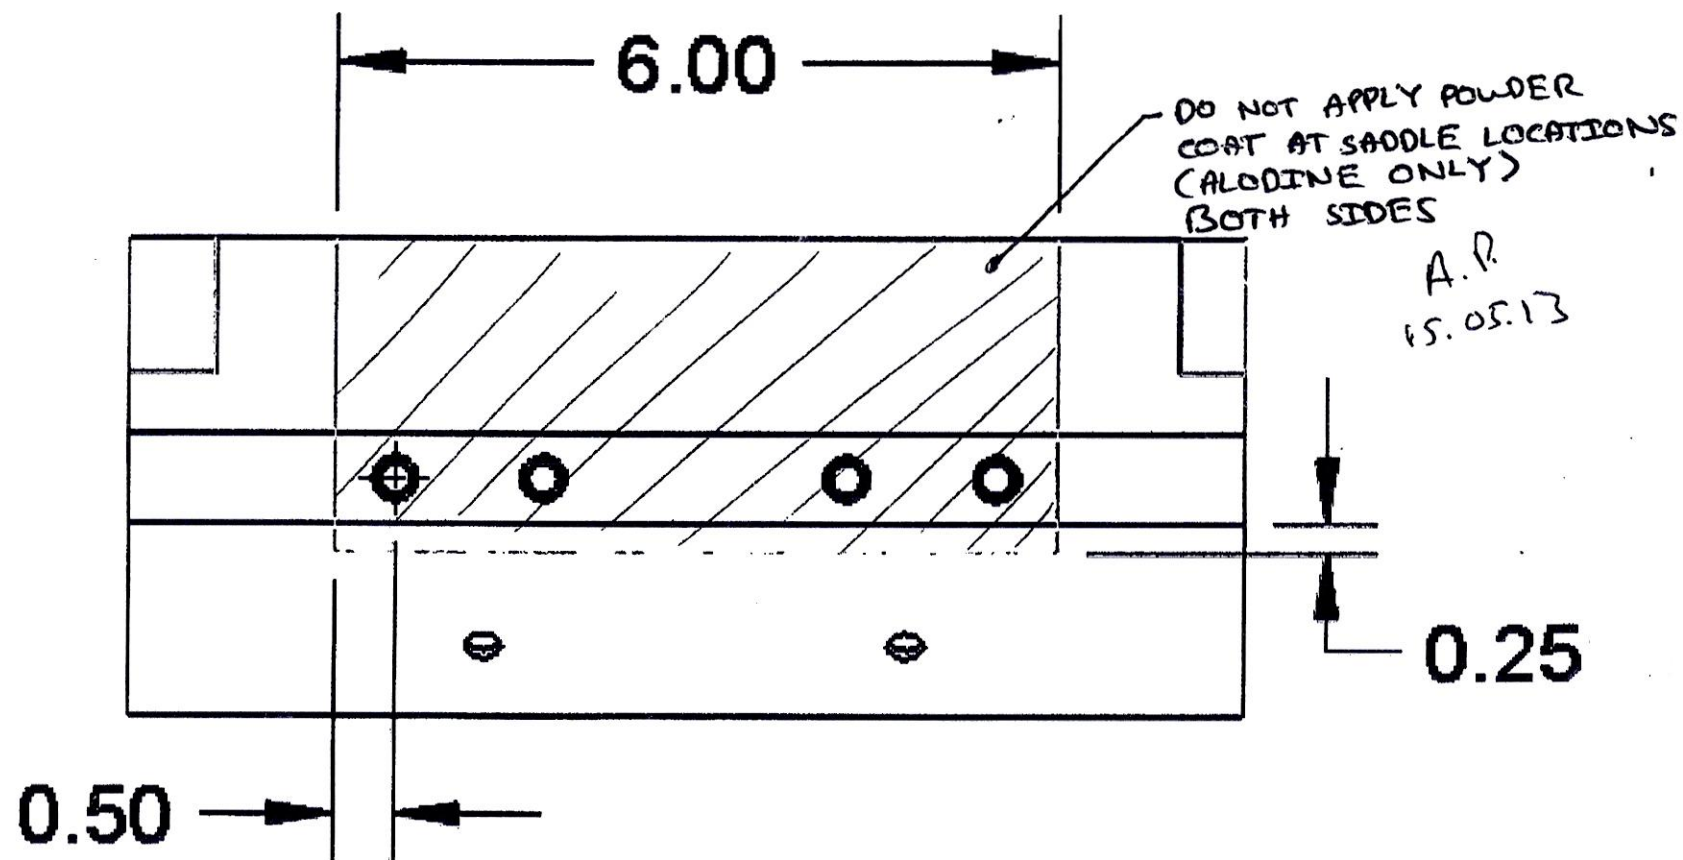

DAS
03
9-88
17-6-6

BATCH# 149541
PART # D119-646-241

Seq. 160

1-Drill holes for cable deflector using D5376-1 Detail Y, prepare for welding.

DP 17-6-6

2-Insert cross bolt spacers. Weld as per QSI 004 and DWG. D3887. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod

M136920

BE 17-06-07

3-Grind welds flush, deburr.

BE 17-06-07

4- Pick D2855-5 cap and transfer drill missing hole. Deburr and identify cap with skid tube.

Seq. 200

1-***MASK AREA SHOWN ON SHEET 7, NOTE 9***

Seq. 240

1-Install insert in D2855-5 Cap.

2-Install cap and seal with Sika flex. Clean excess adhesive.

A/R Sikaflex-240/-291

Sika flex expire date: _____